

Manhole Inspection Summary

Manhole # S11MM_018MH

Printed On: 4/9/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **11MM** Node: **018** Status: **Found**

Insp Date: **1/21/09 10:01 AM**

Incomplete Comments

Crew: **ADS3**
Inspector: **ADS3**
Firm: **ADS**

Location Address: **2317 ELLAMONT ST**

Cross Street: **GWYNNS FALLS PKWY**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **25.** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
75

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **3** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☐ Exists Material:

☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **38** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0.5** nearest .5 ft. Azimuth: **180**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **2** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S11MM_018MH


Printed On: 4/9/2009

Page 2 of 4


Location View



Top View

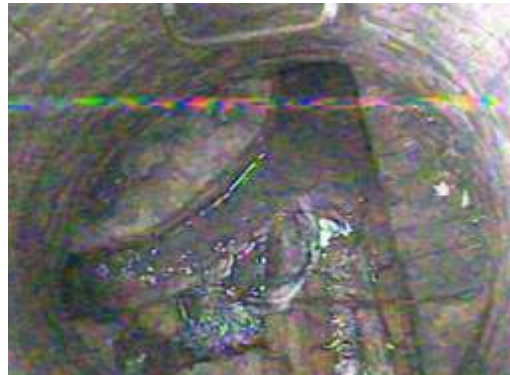

Top View

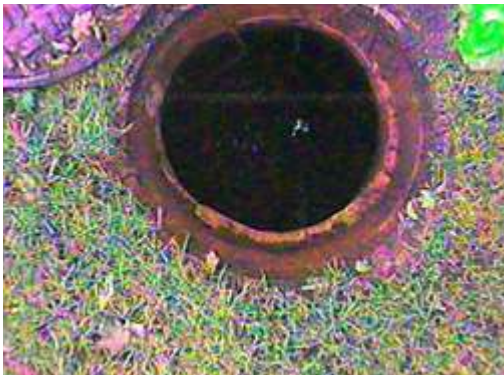

FRAME OFFSET

Defect 1



ROOTS- FINE BARREL

Defect 2



CORRODED STEPS

Manhole Inspection Summary

Manhole # S11MM_018MH

Printed On: 4/9/2009

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.53** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.94** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S11MM_018MH

Printed On: 4/9/2009

Page 4 of 4

6 in. Circular Gravity Sewer

7 O'Clock Inflow

Pipe In @ 7 O'Clock



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.94** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **6.50** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection